

Illustrated Parts List - IPL Update



Product Name(s)

H445 II

Description of change

1. Updated Oil Hose 544 08 42-02 added. Sealing knob removed to simplify assembly.
2. Number change due to a durability update on Ignition Module to 579 63 88-05.
3. New part number due to change of supplier on Tank cap and Fuel tank ventilation.
4. New part number due to removal of plastic bag for Tool, kit.
5. Update on Piston Assy is formal.

Comment

These changes are fully exchangeable.

Introduced from

Serial number / Date	Remark
S/n 20201500384	Valid for Oil hose, 544 08 42-02. For RoW.
S/n 20202500001	Valid for Oil hose, 544 08 42-02. For North America.
S/n 20203401344	Valid for Ignition Module 579 63 88-05 (MBU-052C).



IPL updates

Page Title	Ref. no	New part no.	Name	Excl. part no.	Remark
Clutch & Oil pump	8	544 08 42-02	Oil hose	544 08 42-01	
Ignition system	7	579 63 88-05	Ignition module	579 63 88-03	
Fuel tank	12	522 62 00-03	Tank cap assy	522 62 00-01	Minor correction
	19	501 15 29-01	Fuel tank vent.	537 35 95-01	Minor correction
Accessories	1	501 69 17-01	Combination wrench	503 55 85-04	Minor correction
Cylinder & Piston	2	544 08 84-05	Piston assy	544 08 84-03	

1. Oil hose

New version

Old version

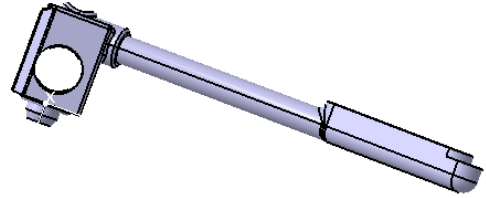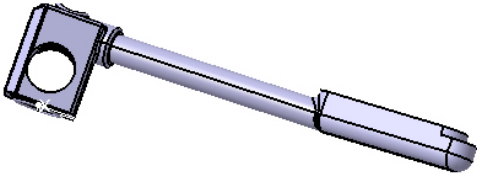

544 08 42-02

544 08 42-01

2. Ignition Module

New version

Old version

Marking:

Marking:

579 63 88-05
MBU – 052C



579 63 88-03
MBU – 052A

579 63 88-05

579 63 88-03